










Date: Tuesday, 14/10/2008 10:00:07 AM
 User: Julie Lecocq

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 350 SKIDTUBE ASSEMBLY RH
Job Number	: 42557		
Estimate Number	: 10265		
P.O. Number	:	Part Number	: D350636012
This Issue	: 14/10/2008	S.O. No.	:
Prsht Rev.	: NC	Drawing Number	: D2750.REVF
First Issue	: / /	Project Number	: N/A
Previous Run	: 42556	Drawing Revision	: F
Written By	:	Material	:
Checked & Approved By	: <u>JUD 08.10.14</u>	Due Date	: 05/11/2008
Comment	: Est Rev:I 02.09.25 Rearranged procedure steps KJ : Est Rev:J 06-03-29 As per Rev D EC : Est Rev:K 06-07.13 As per dsi9343 EC : Est Rev:L 07-07-28 Added SS Wearplates(Rev E) JLM : Verified By:EC : Est Rev:M 08-04-22 update steps 4,13 DD verified by:EC : Est Rev:N 08-09-23 revF as per dwg DD verified by:ec		
Additional Product			
Job Number: 			
Seq. #:	Machine Or Operation:	Description :	
1.0	DC	DOCUMENT CONTROL	
			
Comment: DOCUMENT CONTROL Photocopy blue file and type labels per PPP D350-636-012 CHG 004 <u>JUD 08.10.20</u> <u>for file</u>			
2.0	D26003BENT	Extrusion Bent	
			
Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s) Pick: Qty Part Number Description Batch 1 D2600-3-Bent Extrusion (Bent) <u>B42342</u> <u>①</u> <u>M 8-10-15</u>			
3.0	D2744	Cap	
			
Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s) Cap Batch: <u>B 39242</u> <u>①</u> <u>M 8-10-15</u>			
4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1	
			
Comment: LANDING GEAR RESOURCE 1 1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end 2-Drill pilot holes as per Dwg D2750 sheet 5 (D2750-2 details).Drill using drill Jig DT8150 & DT8863.			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 14/10/2008 10:00:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42557

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

3- Mark fwd end for cutting using Drill Jig DT 8150 & DT8863 and cut as per dwg D2750.

4-Drill pilot holes for Detail M using DT8329

5-Open up holes for Detail K to 0.375" (4 holes per side) blade fitting location holes to 0.500" (total of 5 holes per side) as per dwg D2750. Open holes for ground handling and detail E to 0.500" (8 holes per side)

6-Drill pilot holes for wearplates as per Dwg D2750 using DT8108

****Make sure that wearplate holes are on bottom of tube*****

Open 4 aft wearplate holes to 0.250". Open remaining wearplate holes to 0.297".

7-Open up holes of Detail J to 0.297" (total of 2 holes per side)

9-Weld D2744 Cap as per Dwg D2750 and QSI 004.Fill grooves in bend left from bending as per QSI 004

A/R

Aluminum Rod

mk9223

SE 08/10/16

10-Grind welds flush as per Dwg D2750

JD 8-10-16

SE 8-10-17

*M
8-10-15*

5.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

08/10/17 (X)

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/10/17 (X)

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

JD 8-10-20

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DP 8-10-21

9.0

D2739

350 I Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Web

Batch:

42562

JD 8-10-21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 14/10/2008 10:00:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42557

Part Number: D350636012

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

10.0	D34901	Cross Bolt Spacer
------	--------	-------------------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Crossbolt spacer

Batch:

842185

3P

842780

IR

BE 08/10/27

11.0	D34903	Cross Bolt Spacer
------	--------	-------------------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Crossbolt spacer

Batch:

842186

BE 08/10/27

12.0	D2743	Crossbolt Spacer
------	-------	------------------



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

Crossbolt Spacer

Batch:

841113

BE 08/10/27

13.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
------	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1-Open up holes of Detail L and ground handling to 0.625" (total of 8 holes per side) as per dwg D2750.

2-Open up holes of Detail K to 0.750" (total of 4 holes per side)
as per dwg D2750.

3-Open float holes to .500" (4 per Side)

4-Chamfer holes of Detail K, L, ground handling and float holes per dwg D2750 (welding instructions on sheet 9)

5-Deburr and blow out all chips from inside of tube

6-Prepare tube for welding, remove alodine as required.

7-Bond web D2739 in place as per QSI 015

A/R

Sikaflex-291

batch:

109238

exp. date:

8-11-01

8- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D2750 & QSI004
(welding instructions on sheet 9)

A/R

Aluminum Rod

batch:

109213

BE 08/10/27

JP

8-10-21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 14/10/2008 10:00:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42557

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

9-Grind welds flush as per Dwg D2750

AWM
8-10-27

10-Spot face ground handling holes section AR-AR (total of 4 places per side) as per dwg D2750

11-Deburr holes

14.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

5 08/10/22 (40)

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

5 08/10/22 (20)

16.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

M. 08/11/01

17.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

11-10 OF
320
11-40

M. 08/11/01

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

08-11-05 (X)

19.0

ALS41032225

Insert



Comment: Qty.: 38.0000 Each(s)/Unit Total: 38.0000 Each(s)

Insert

Batch: M100621

08-11-05 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 14/10/2008 10:00:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42557

Part Number: D350636012

Job Number:



Seq. #: Machine Or Operation: Description :

20.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1
1-Install inserts as per dwg D2750

HL 08-11-05 (X)

21.0

D2745

Bushing



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)
Bushing
Batch: 13410726

HL

22.0

D37911

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Wearplate
Batch: 13412418

HL

23.0

D37931

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Wearshoe
Batch: 134124179

HL

24.0

D37933

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Wearshoe
Batch: 13412247

HL

25.0

D37941

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Gasket
Batch: 1342480

HL

26.0

D37943

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Gasket
Batch: 1343116

HL

08-11-05 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 14/10/2008 10:00:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42557

Part Number: D350636012

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

27.0	D353525	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1341633

JH

28.0	D353625	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: 1342234

JH

29.0	D35371	Wearpad
------	--------	---------



Comment: Qty.: 3.0000 Each(s)/Unit Total : 3.0000 Each(s)

WEARPAD

Batch: 1342235

JH

30.0	D36311	Washer
------	--------	--------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

WASHER

Batch: 1341141

JH

31.0	D3488042	Blade Fitting Assembly, RH
------	----------	----------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Blade Fitting, RH

Batch: 1342415

JH

32.0	D3492041	Plug Assembly
------	----------	---------------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: 1342637

JH

33.0	D3492043	Plug Assembly
------	----------	---------------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: 1342183

JH

08.11.05

(K1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 14/10/2008 10:00:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42557

Part Number: D350636012

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

34.0	AN3C5A	Bolt
------	--------	------



Comment: Qty.: 34.0000 Each(s)/Unit Total: 34.0000 Each(s)
Bolt
Batch: M109752 *JA*

35.0	AN3C6A	BOLT
------	--------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)
Bolt
Batch: M108880 *JA*

36.0	AN6C44A	BOLT
------	---------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)
BOLT
Batch: M109765 *JA*

37.0	AN8C35A	BOLT
------	---------	------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
BOLT
Batch: M1106896 *JA*

38.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 38.0000 Each(s)/Unit Total: 38.0000 Each(s)
washer
Batch: M1109545 *JA*

39.0	AN960C816L	WASHER
------	------------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
WASHER
Batch: M1109632 *JA*

40.0	MS210436	NUT
------	----------	-----



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)
NUT
Batch: M109249 *JA*

08-11-04

(X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 14/10/2008 10:00:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42557

Part Number: D350636012

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

41.0	MS21083C8	NUT
------	-----------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

NUT

Batch: M1109545

WASHER

42.0 NAS1515H3L



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

WASHER

Batch: M1108961

43.0 HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

✓ 1-Inspect for Foreign Objects

✓ 2-Spray inside of tube with "LPS-3"
batch: M1107912

3-Install blade fitting D3488-042, wearshoes and ground handling hardware as per dwg D2750

✓ SIKA FLEX 241

BATCH: M1109499

EXP DATE: 08/11

✓ 4-Coat all exposed fasteners with "LPS Procyon"

batch: M1104251

SS 08-11-05 (X)

44.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

SS 08/11/05 (X)

45.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

46.0

D2741

Blade, 350 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Blade

Batch: 40724

SS 08/11/05 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 14/10/2008 10:00:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42557

Part Number: D350636012

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

47.0	AN960C816L	WASHER
------	------------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: ~~M106043~~ M109632

48.0	MS21083C8	NUT
------	-----------	-----



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Nut

Batch: M109740

49.0	AN8C21A	BOLT
------	---------	------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: M109772

50.0	NAS1515H8L	WASHER
------	------------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: M108964

51.0	D34931	Washer
------	--------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: 40289 40829

52.0	D35321	Spacer
------	--------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

spacer

Batch: 42350

53.0	QC4	INSPECT 100% KITS FOR COMPLETENESS
------	-----	------------------------------------



Comment: INSPECT 100% KITS FOR COMPLETENESS

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 14/10/2008 10:00:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH

Job Number: 42557

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

54.0

PACKAGING 1

PACKAGING RESOURCE #1



lec 72



(2)

Comment: PACKAGING RESOURCE #1

Package as per PPP D350-636-012

Rev C

8/11/5

54

55.0

QC21

FINAL INSPECTION/W/O RELEASE



08/11/05

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF 08-11-05

B42557

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

NO. 177

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Brendy Elliot
Job number: 842449
Part number: 1350-636-013
Description: Skid tube
Welding Process: Tig[☒] Mig[]
Base material: Aluminum
Current: AC[☒] DC[]

TEST REQUIREMENTS AND RESULTS

Visual:
Penetration:

pass[☒] fail[]
pass[☒] fail[]

UNACCEPTABLE

Cracks:
Undercut:
Pin holes:
Overlap (cold lap)
Porosity (surface):
Coloration:

pass[☒] fail[]
pass[☒] fail[]
pass[☒] fail[]
pass[☒] fail[]
pass[☒] fail[]
pass[☒] fail[]

Qualifier David Smith Date of Test Coupon 08/10/20

Welder Brendy Elliot Date of Test Coupon 08/10/20

The above named individual is qualified in accordance with AWS D17.1.2001 to weld


QTY -041	QTY -042	QTY -043	QTY -044	PART NUMBER	DESCRIPTION
X				D2750-041	350 SKIDTUBE ASSEMBLY, LH
	X			D2750-042	350 SKIDTUBE ASSEMBLY, RH
		X		D2750-043	350 SKIDTUBE ASSEMBLY, LH
			X	D2750-044	350 SKIDTUBE ASSEMBLY, RH
1	1	1	1	D2739	WEB
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
1	1	1	1	D3535-25	WEARSHOE
1	1	1	1	D3536-25	GASKET
3	3	3	3	D3537-1	WEARPAD
8	8	8	8	D3631-1	WASHER
1	1	1	1	D3791-1	WEARPLATE
1	1	1	1	D3793-1	WEARSHOE
1	1	1	1	D3793-3	WEARSHOE
1	1	1	1	D3794-1	GASKET
1	1	1	1	D3794-3	GASKET
38	38	38	38	ALS4-1032-225	INSERT (OR ALS7-1032-225, AKS4-1032-225, AELS-1032-225)
34	34	34	34	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN6C44A	BOLT
1	1	1	1	AN8C35A	BOLT
38	38	38	38	AN960C10L	WASHER
1	1	1	1	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
1	1	1	1	MS21083C8	NUT
4	4	4	4	NAS1515H3L	WASHER

GENERAL NOTES:


- 1) MATERIAL: MAKE D2750-1/-2/-3/-4 FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
- 2) FINISH:
ACID ETCH, ALONDE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: D2750-041/-042/-043/-044 = 26.5 LBS
- 8) WELD PER DART QSI 004
- 9) INSTALL ALS4-1032-225 INSERTS AFTER FINISH AS INDICATED. DRILL 'F' SIZE HOLES ($\phi 0.297$) FOR WEARSHOE INSERTS
- 10) FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 KSI
MINIMUM ULTIMATE TENSILE STRENGTH = 38 KSI
- 11) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS.
COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF
POWDER COATING WITH MEK DEGREASER.
- 12) SPACER AND PLUG INSTALLED SAME AS SECTION AJ-AJ EXCEPT HORIZONTAL
- 13) SPACER AND PLUG INSTALLED SAME AS SECTION AP-AP EXCEPT HORIZONTAL

SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 40557

F	INCORPORATE DSI 9413; QTY (3) D3537-1 WAS QTY (5) (ZN C8-1); D3791-1/-3 REPLACES D3535-13/-35 (ZN C8-1); D3794-1/-3 REPLACES D3536-13/-35 (ZN B8-1); ADD D3791-1 (ZN C8-1); WEARSHOE HOLES UNDER FWD/AFT SADDLE REMOVED (8 PL). WEARSHOE HARDWARE QTY UPDATED (ZN B8-1); D3488-041/-042 HARDWARE UPDATED (ZN C1-8, 9, 10, 11); ADD NOTE 12 AND 13 (ZN A6-1); REASON: REF. NCR 08-043	PH	08.07.16
E	CHANGE TO STAINLESS STEEL WEARPLATES; ADD RUBBER GASKETS; CHANGE INSERTS; ADD D3631-1; REMOVE QTY (38) NAS1515H3L; REMOVE QTY (10) NAS1515H8L; REMOVE D2741, QTY (2) AN960C816; REMOVE QTY (2) MS21083C8	CB	07.05.17
D	ADD HOLES AND SPACERS FOR APICAL FLOATS; INCORPORATE DEO 9133/9157	PH	06.01.05
C	ADD D2750-3/D2750-4; INCORPORATE D2738 AND D2740	CP	98.11.18
B	CHANGE MS24694-S293 TO AN8-16A	CP	98.09.01
A	NEW ISSUE	DS	98.04.16
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	08.07.16		
DART AEROSPACE USA, INC. PORT HADLOCK, WA			
DRAWING NO. D2750		REV. F SHEET 1 OF 11	
TITLE 350 SKIDTUBE ASSEMBLY		SCALE NTS	
COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

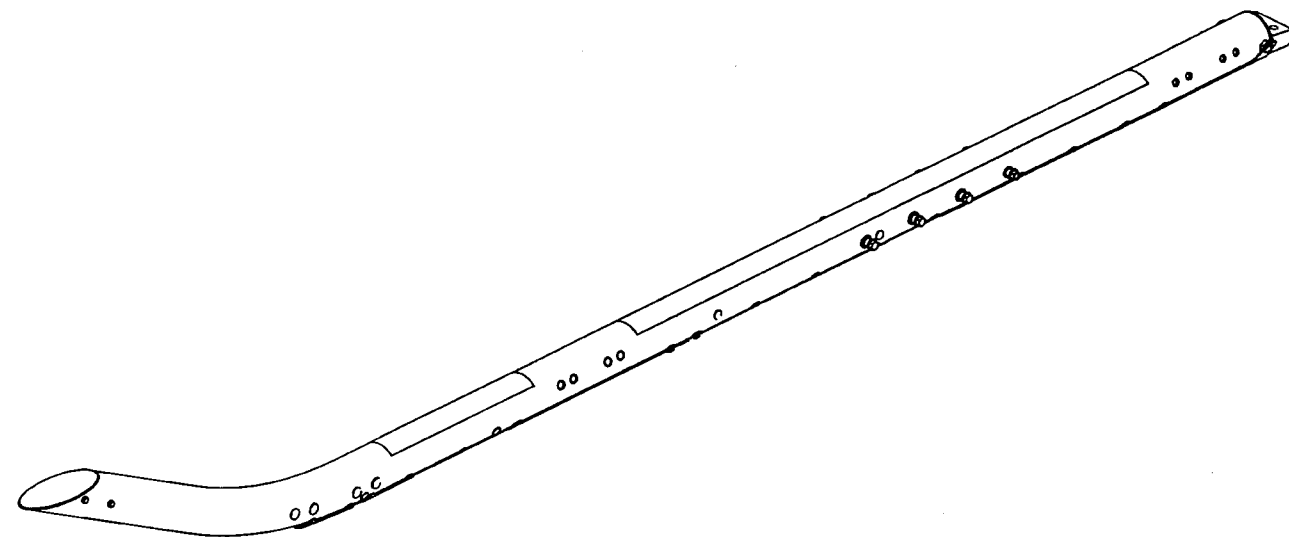


D2750-041 350 SKIDTUBE ASSEMBLY, LH

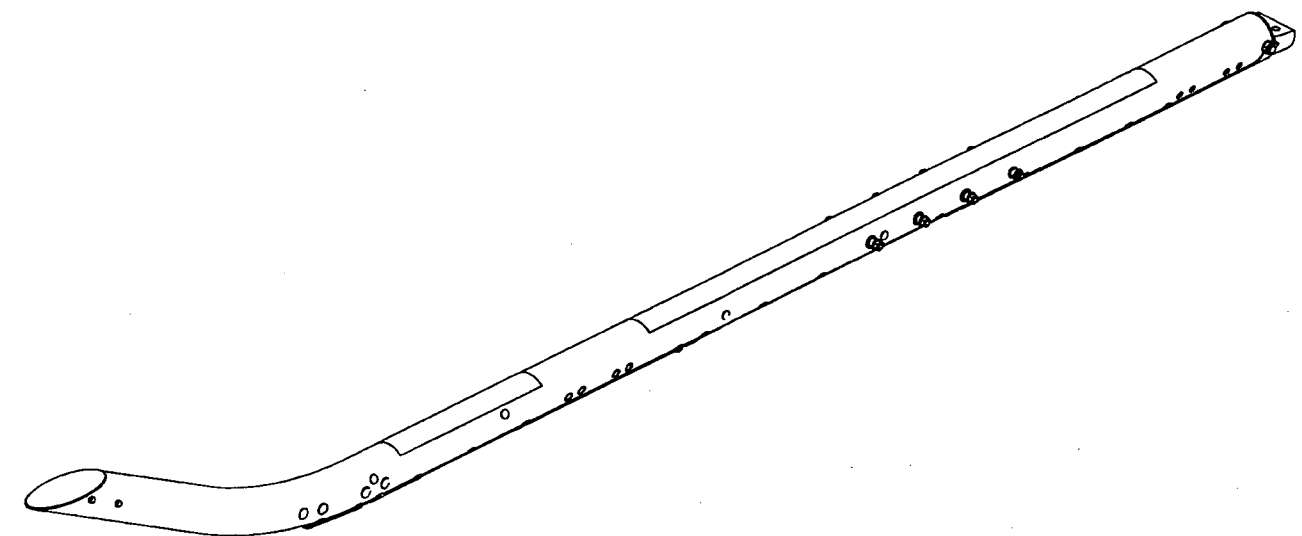


D2750-042 350 SKIDTUBE ASSEMBLY, RH

SHOP COPY
RETURN TO
ENGINEERING
RELEASED
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 45557

DESIGN	REV	DART AEROSPACE USA, INC.	
DRAWN	AD	PORT HADLOCK, WA	
CHECKED	SA	DRAWING NO.	REV. F
MFG. APPR.	MA	D2750	SHEET 2 OF 11
APPROVED	ME	TITLE	SCALE
DE APPR.	TH	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

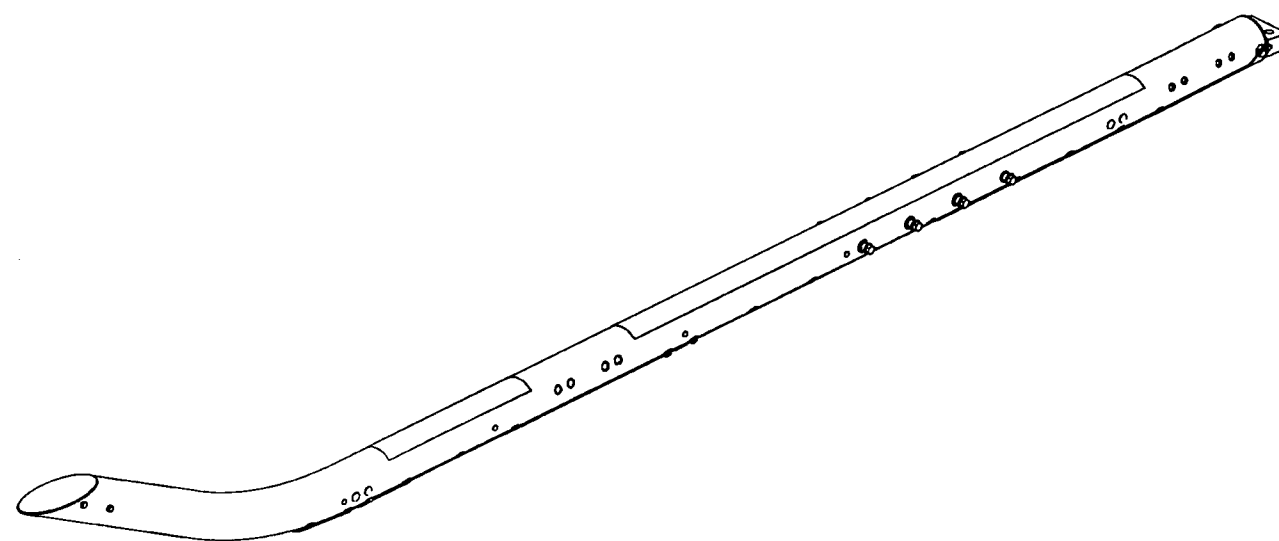

D2750-043 350 SKIDTUBE ASSEMBLY, LH

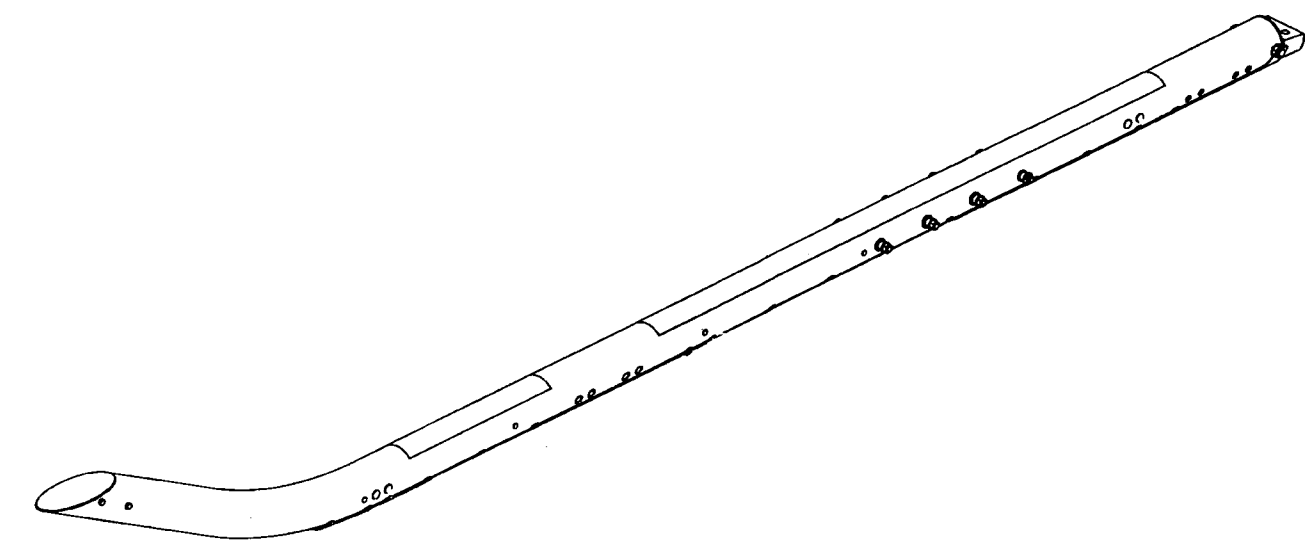


D2750-044 350 SKIDTUBE ASSEMBLY, RH

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42557


RELEASED
68-09-22/111

DESIGN	PD	DART AEROSPACE USA, INC.	
DRAWN	PD	PORT HADLOCK, WA	
CHECKED	NA	DRAWING NO.	REV. F
MFG. APPR.	NA	D2750	SHEET 3 OF 11
APPROVED	NA	TITLE	SCALE
DE APPR.	NA	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	<small>COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.</small> <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


8 7 6 5 4 3 2 1

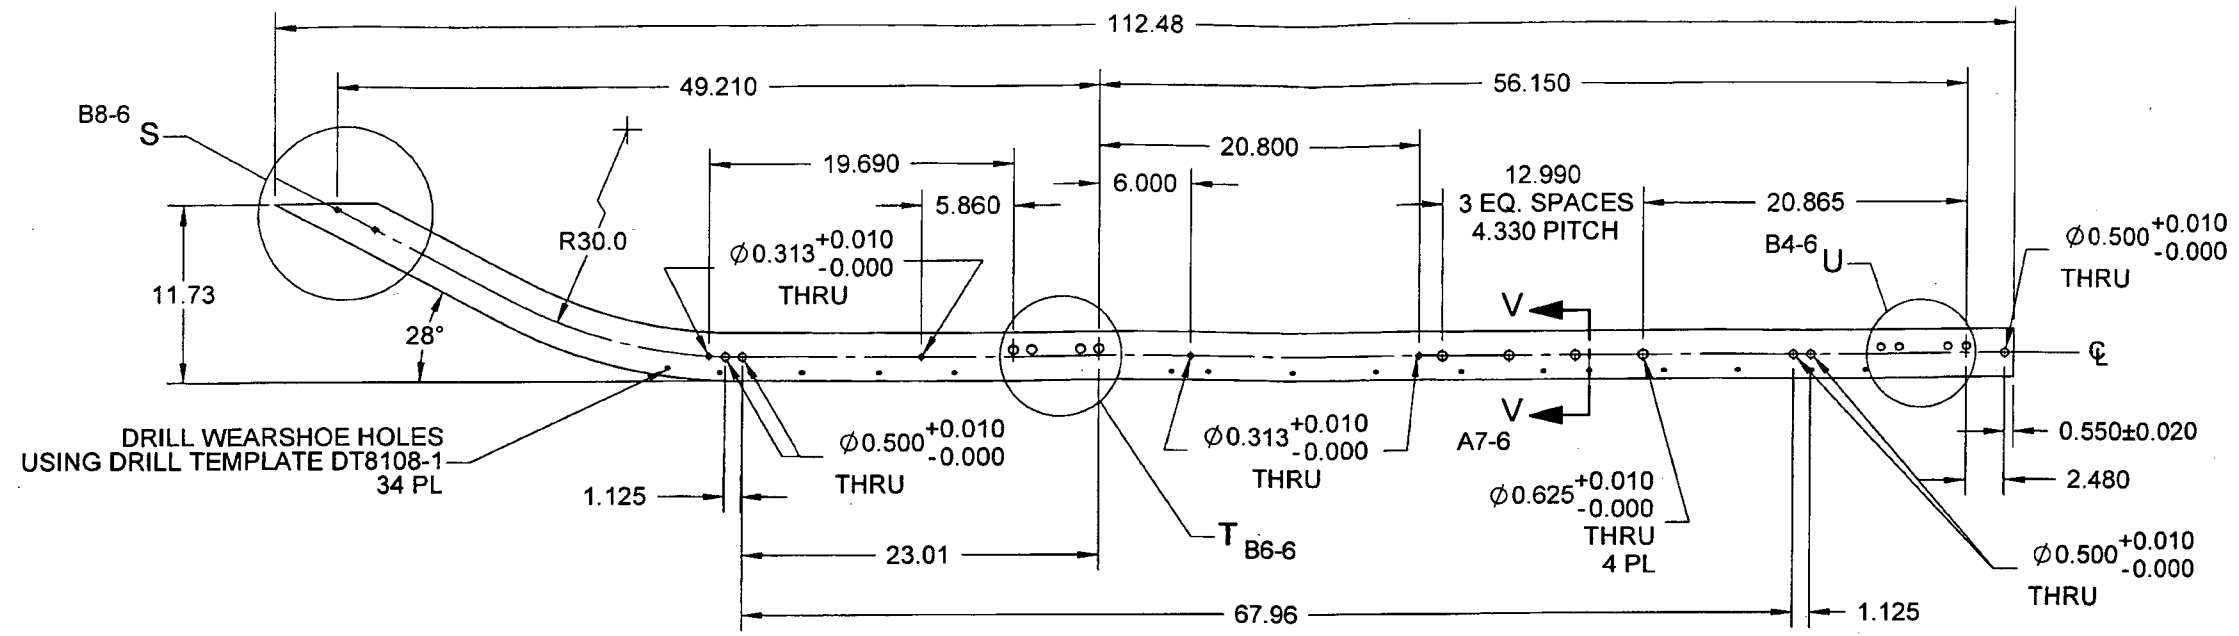


D2750-3 LH SKIDTUBE

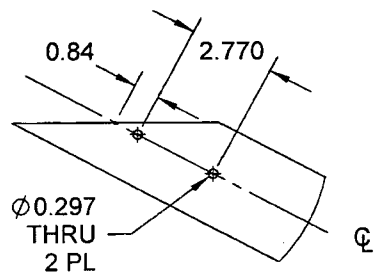


DETAIL S
SCALE 2X

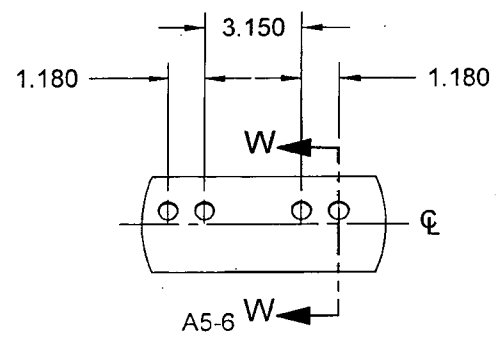


DETAIL T
SCALE 2X

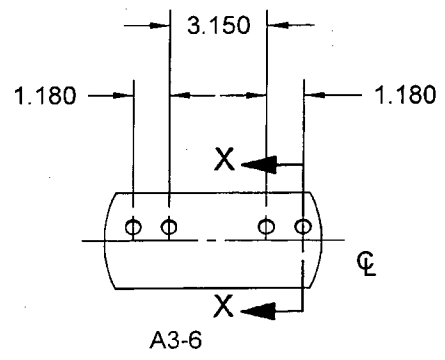


DETAIL U
SCALE 2X

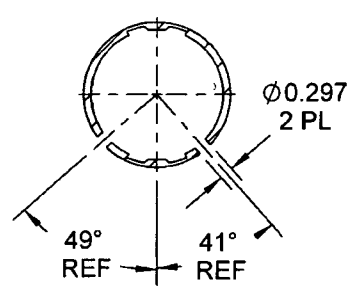

SECTION V-V
SCALE 3X, 17 PL

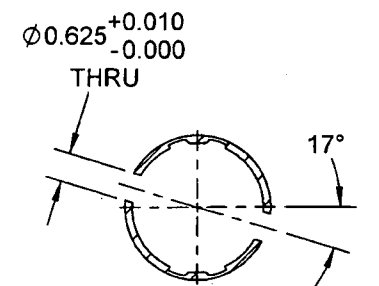

SECTION W-W
SCALE 3X, 4 PL

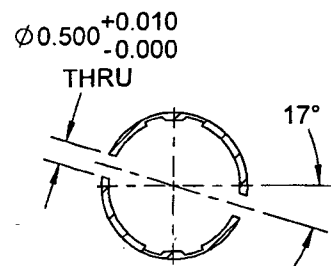


SECTION X-X
SCALE 3X, 4 PL

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42557


RELEASED
08-07-16

DESIGN		DART AEROSPACE USA, INC.	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2750	SHEET 6 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	


8 7 6 5 4 3 2 1

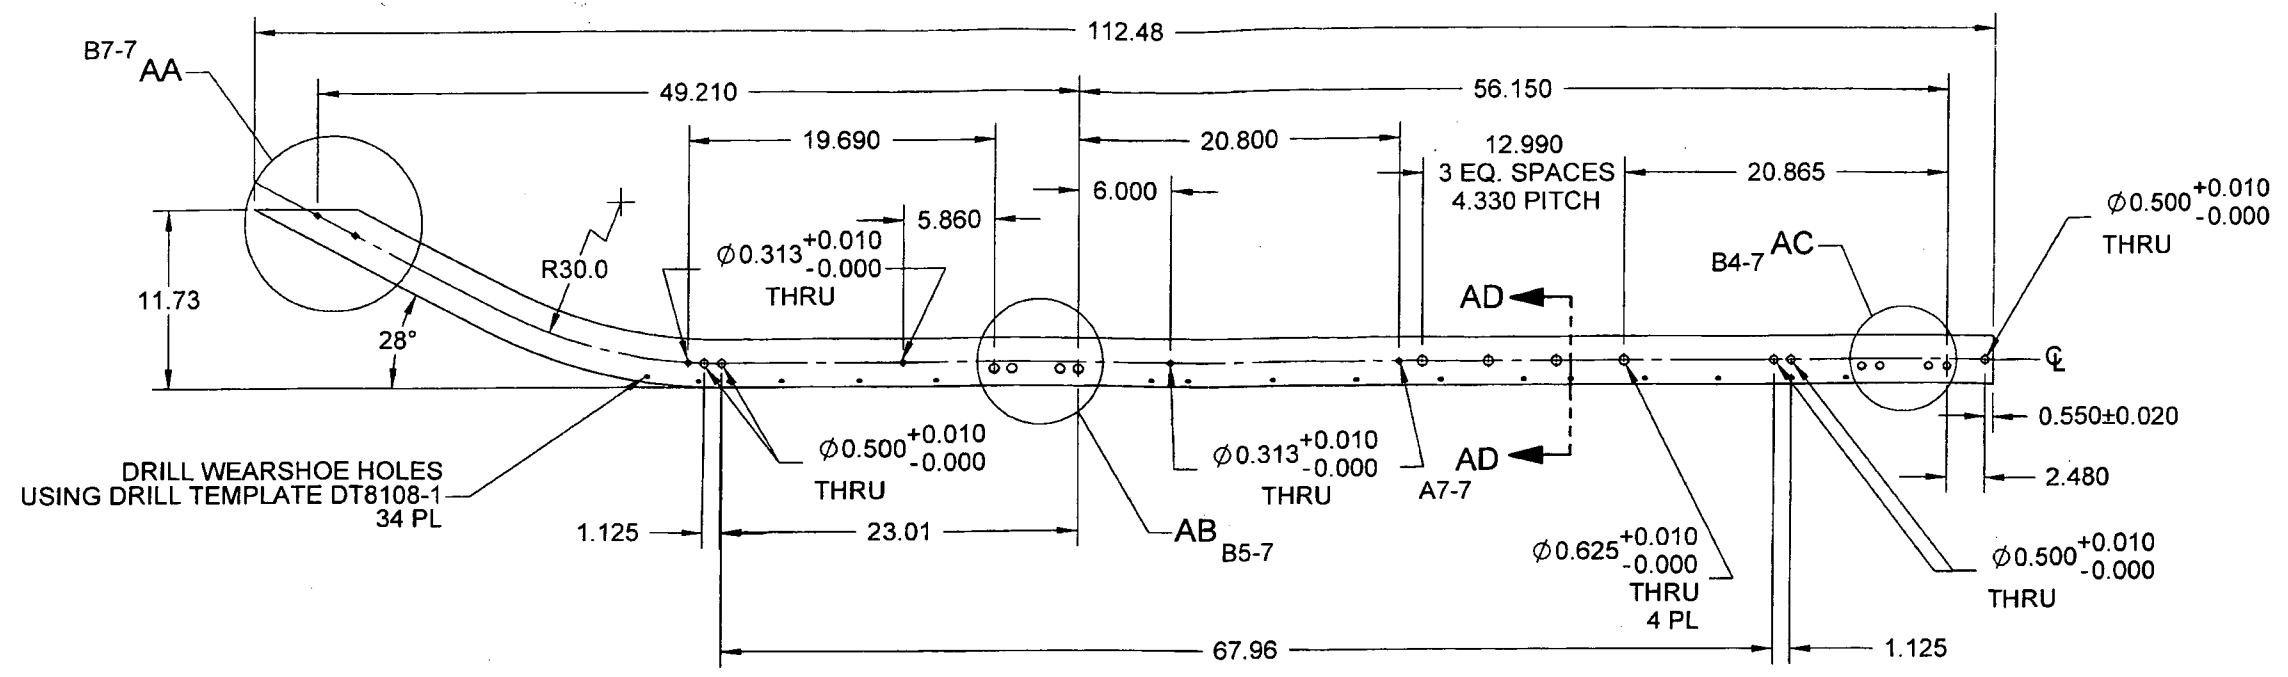


D2750-4 RH SKIDTUBE

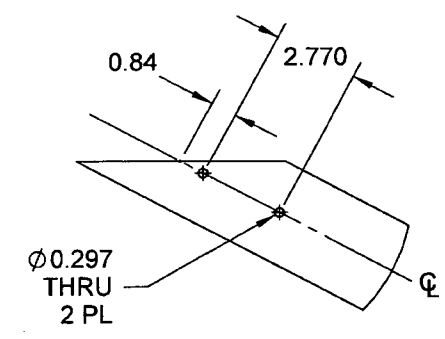


DETAIL AA
D7-7
SCALE 2X

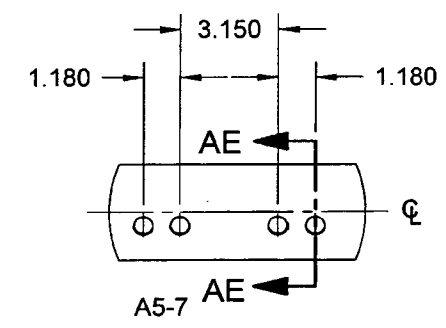


DETAIL AB
C4-7
SCALE 2X

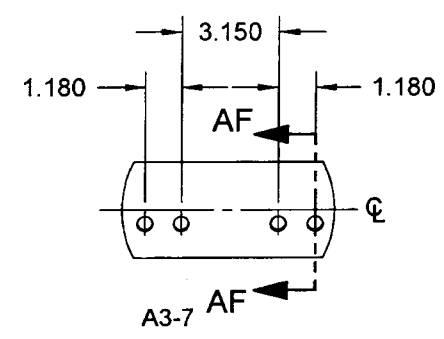


DETAIL AC
D3-7
SCALE 2X

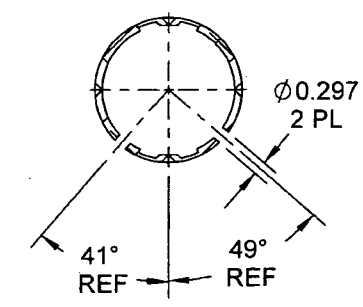

SECTION AD-AD
D3-7
SCALE 3X, 17 PL

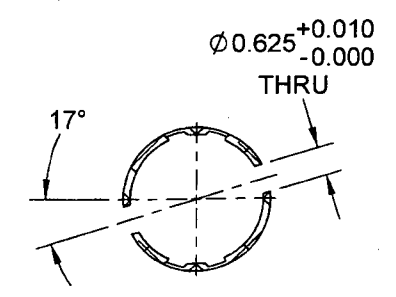

SECTION AE-AE
B6-7
SCALE 3X, 4 PL

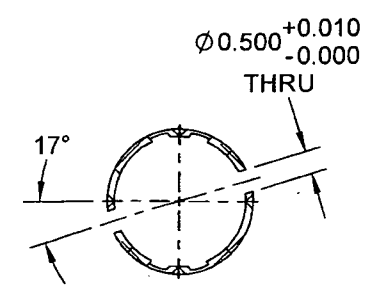


SECTION AF-AF
B4-7
SCALE 3X, 4 PL

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42577


RELEASED
08-09-22-10

DESIGN	REV	DART AEROSPACE USA, INC.	
DRAWN	REV	PORT HADLOCK, WA	
CHECKED	REV	DRAWING NO. D2750	REV. F
MFG. APPR.	REV	SHEET 7 OF 11	
APPROVED	REV	TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS
DE APPR.	REV	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.	
DATE	08.07.16	THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	





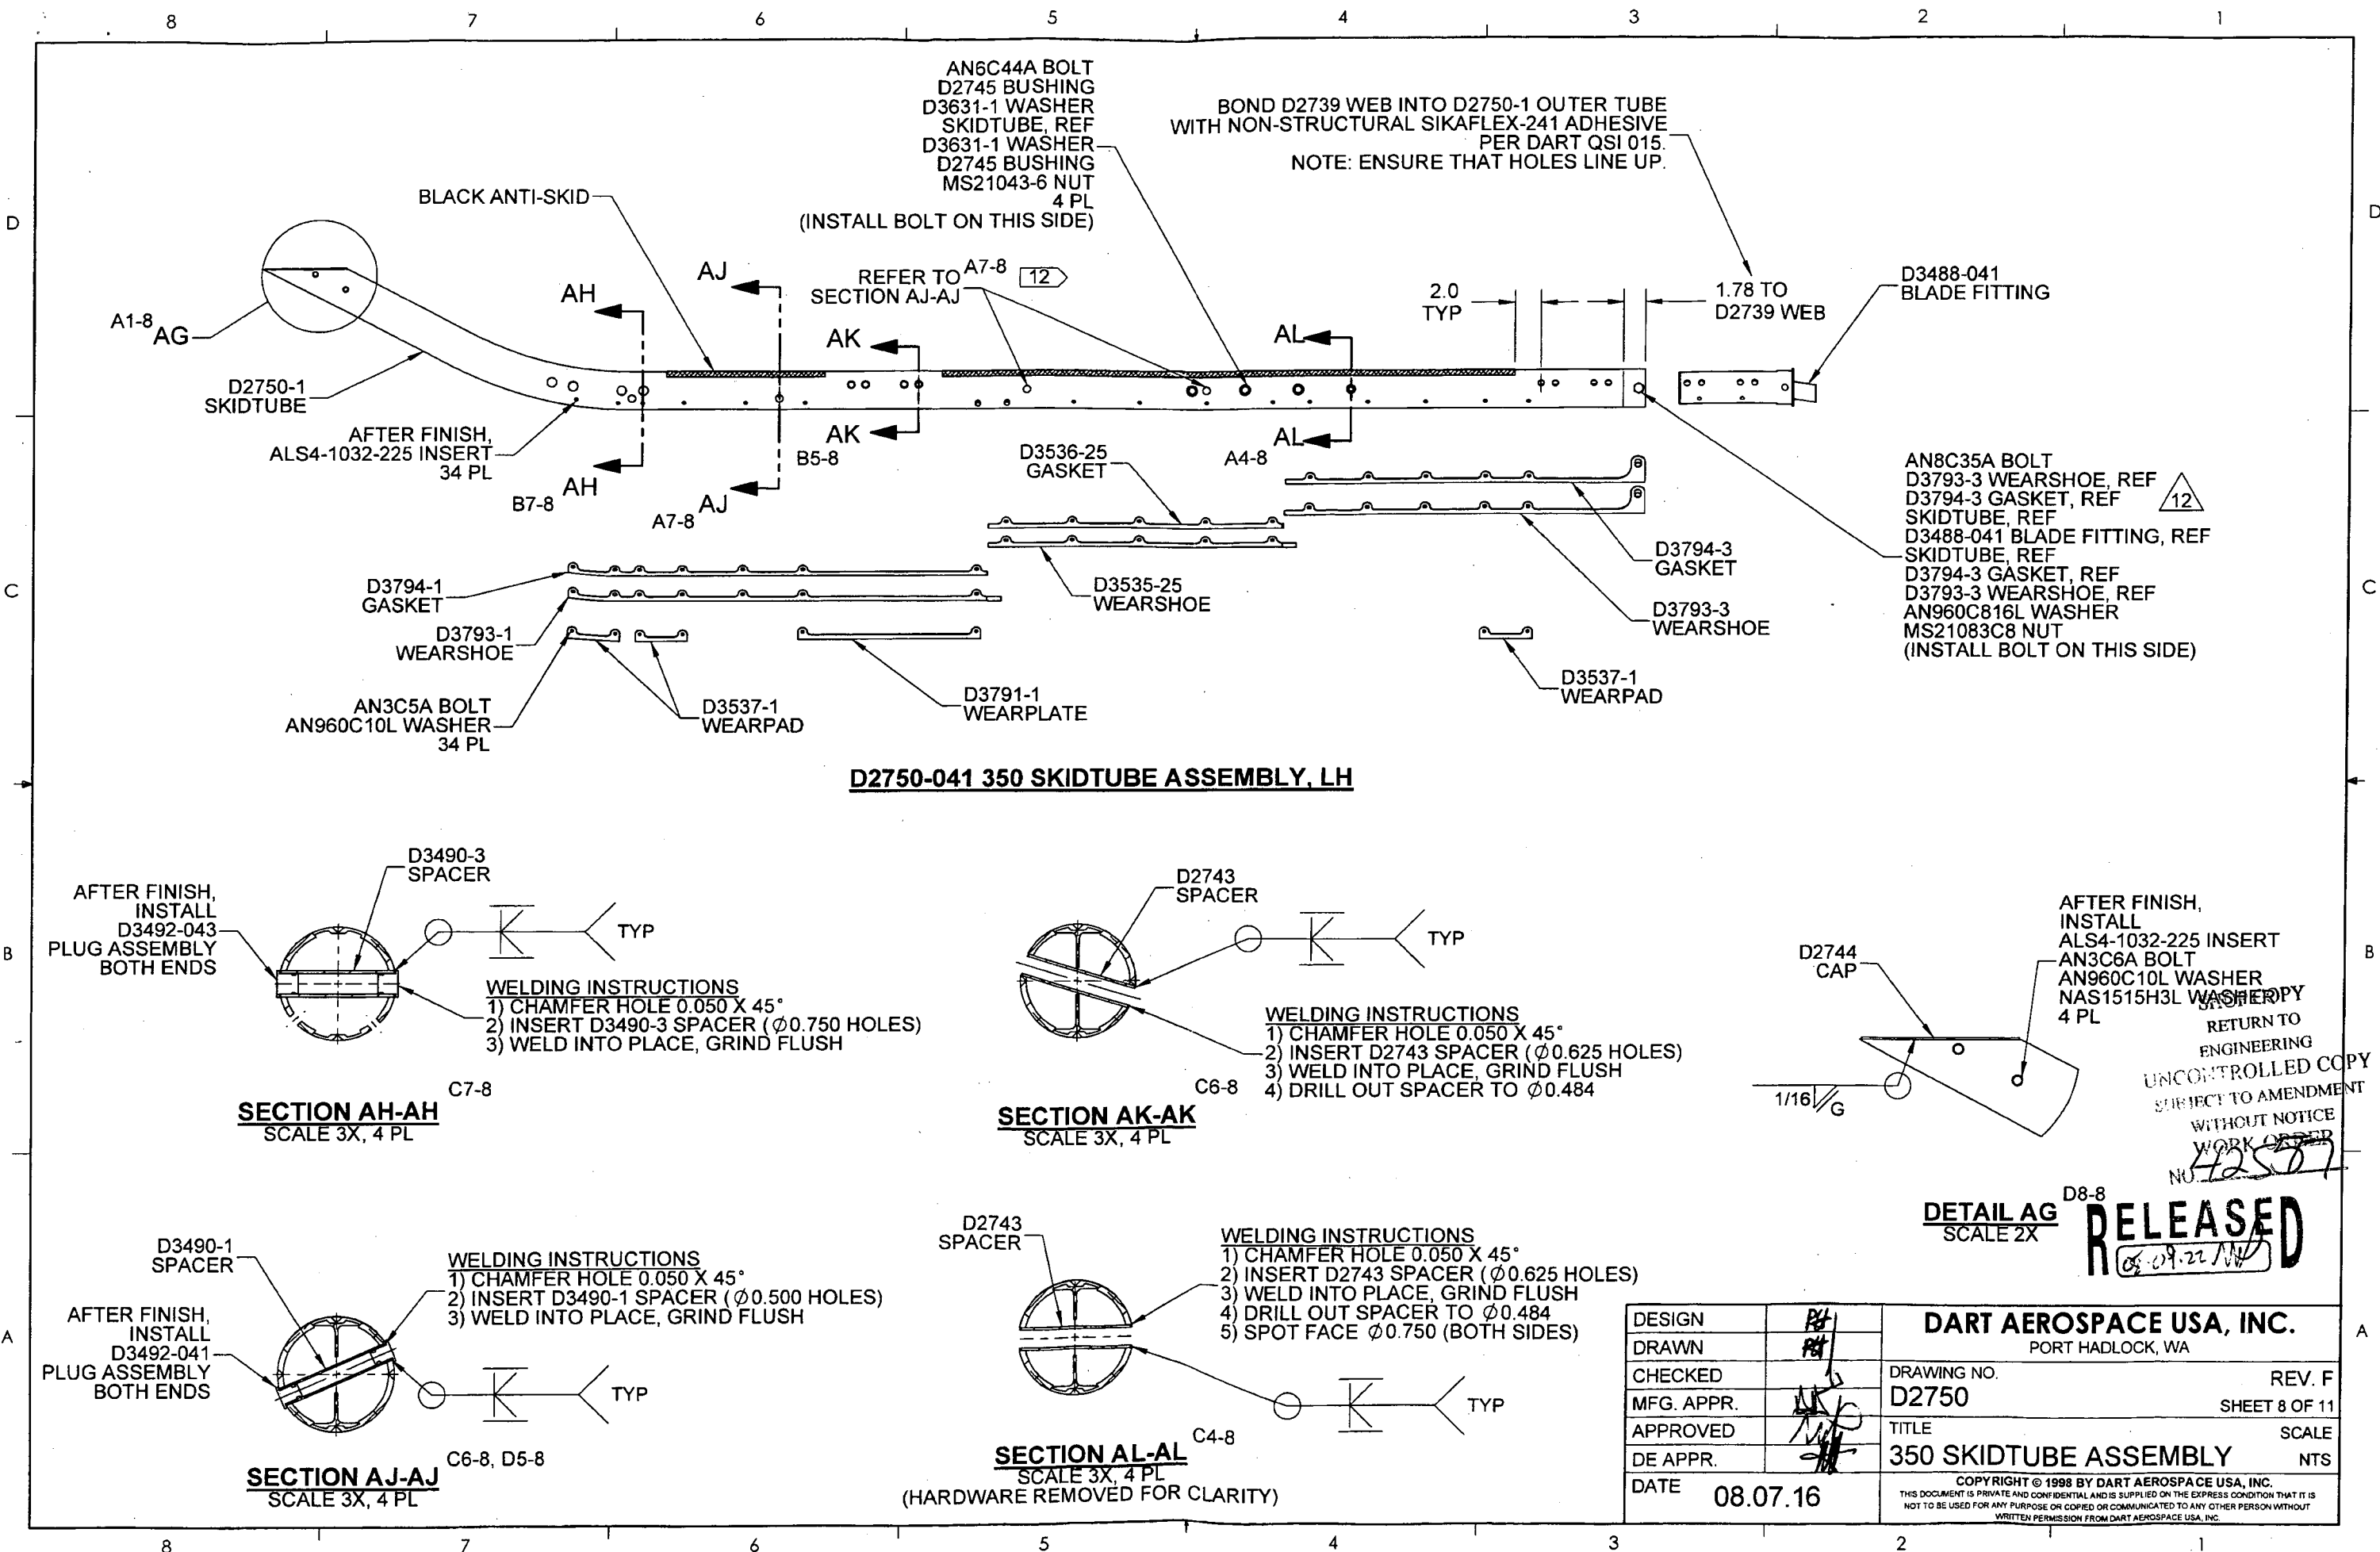


DESIGN	PA	DART AEROSPACE USA, INC.	
DRAWN	PA	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2750	SHEET 8 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

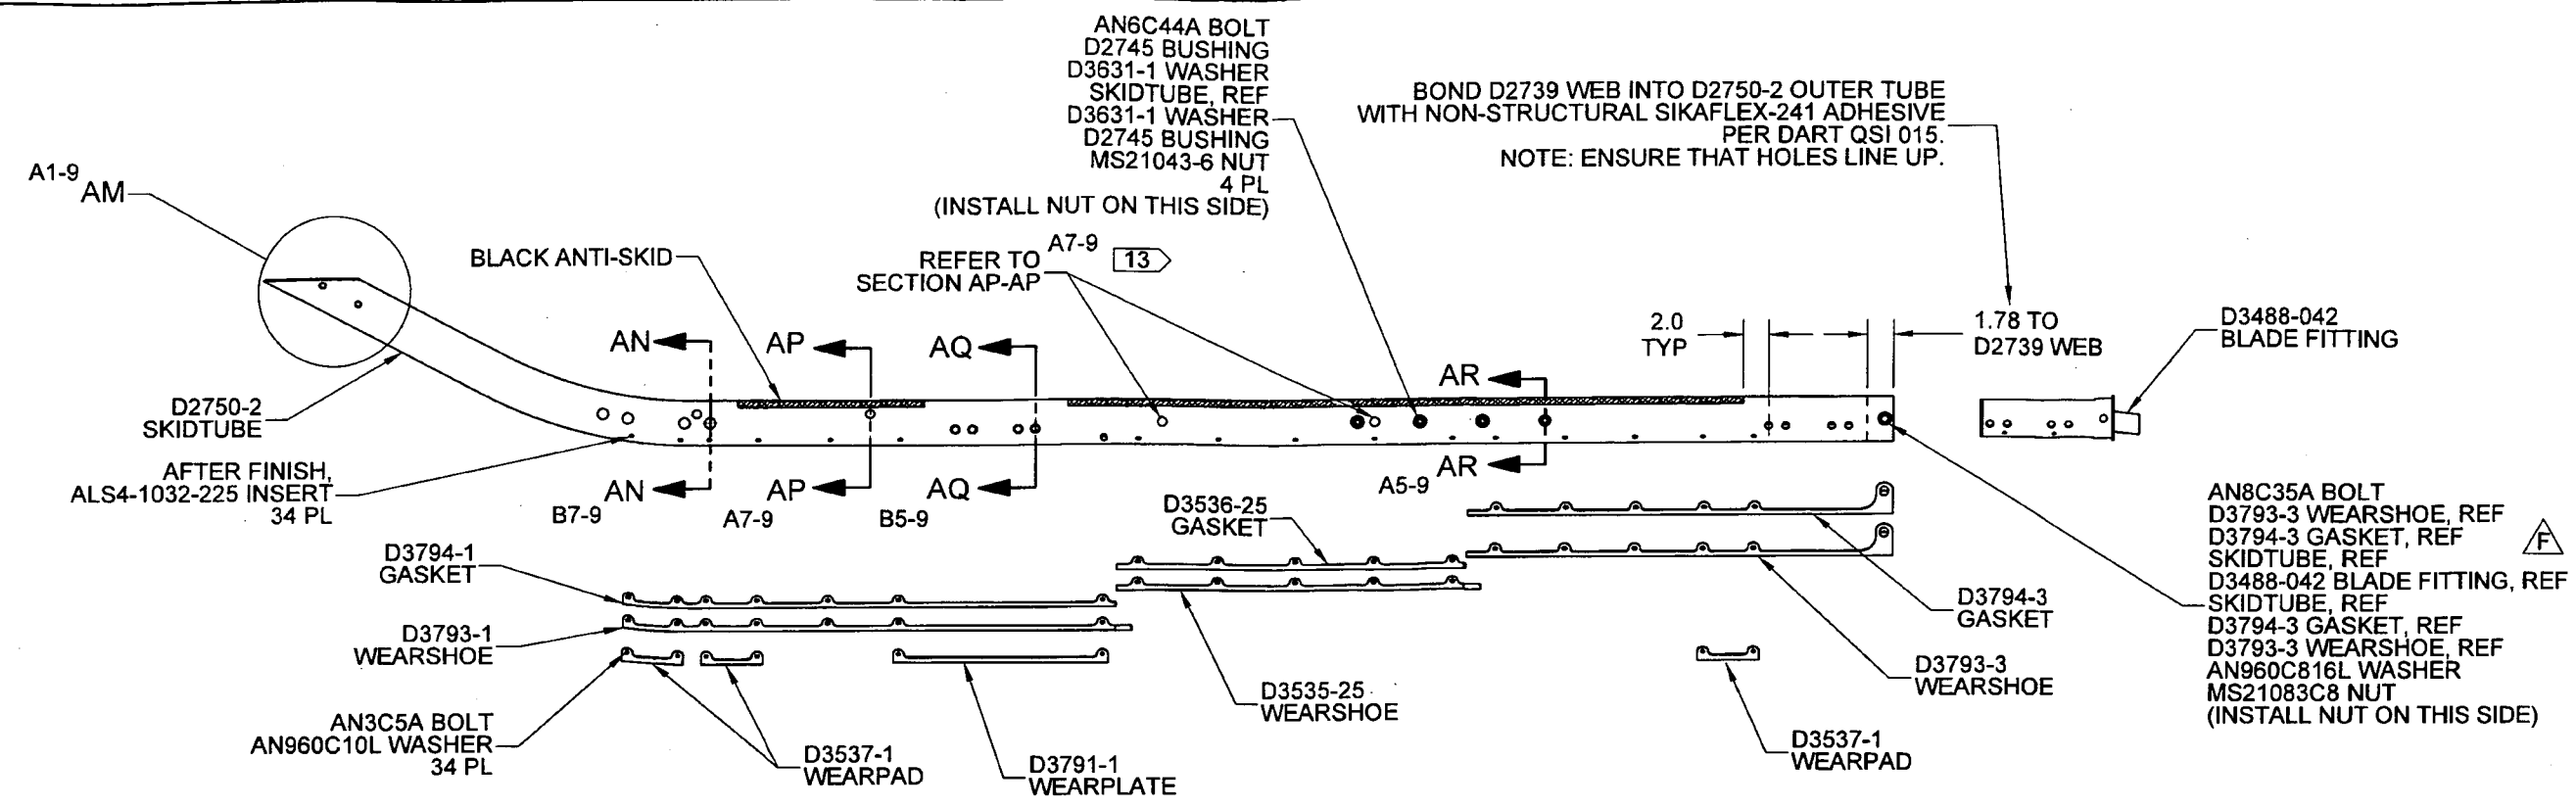


D2750-042 350 SKIDTUBE ASSEMBLY, RH

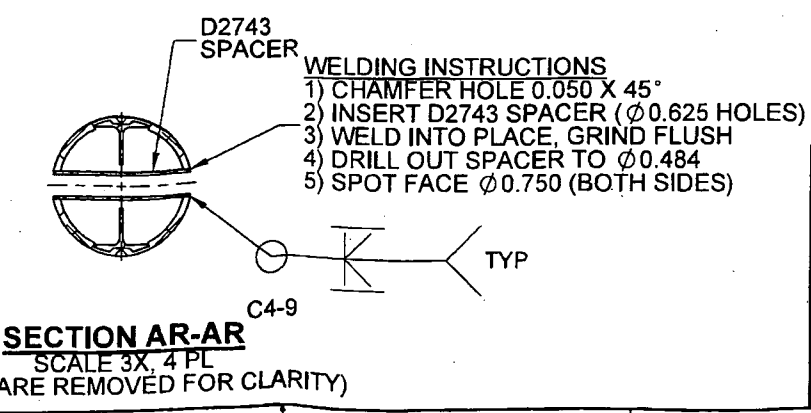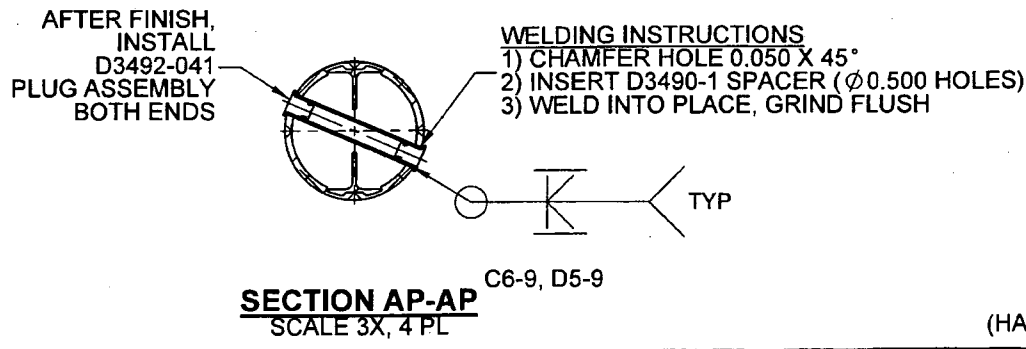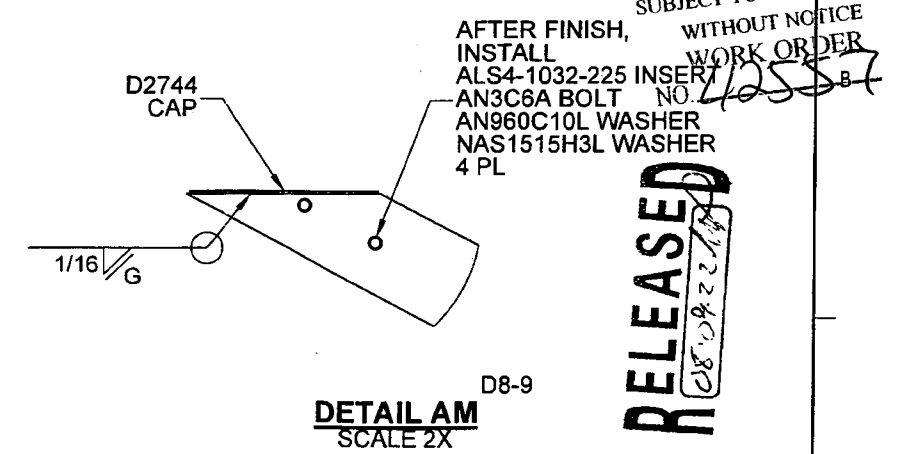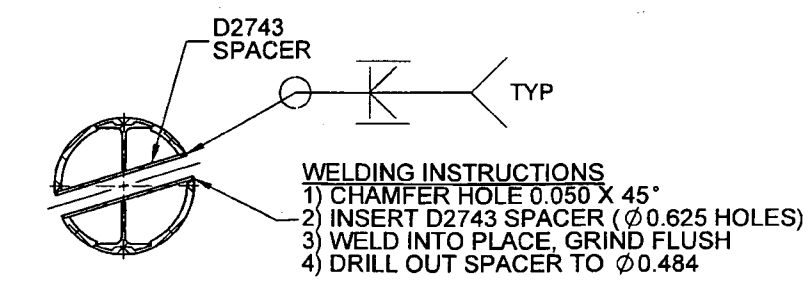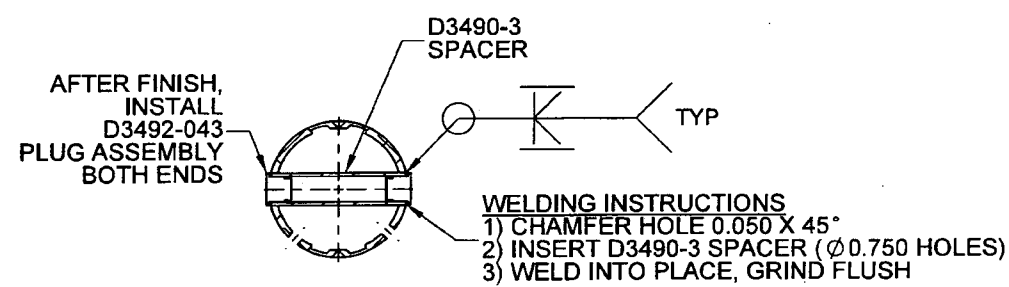

DESIGN	PH	DART AEROSPACE USA, INC.	
DRAWN	PH	PORT HADLOCK, WA	
CHECKED	PH	DRAWING NO.	REV. F
MFG. APPR.	PH	D2750	SHEET 9 OF 11
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
425587

8 7 6 5 4 3 2 1

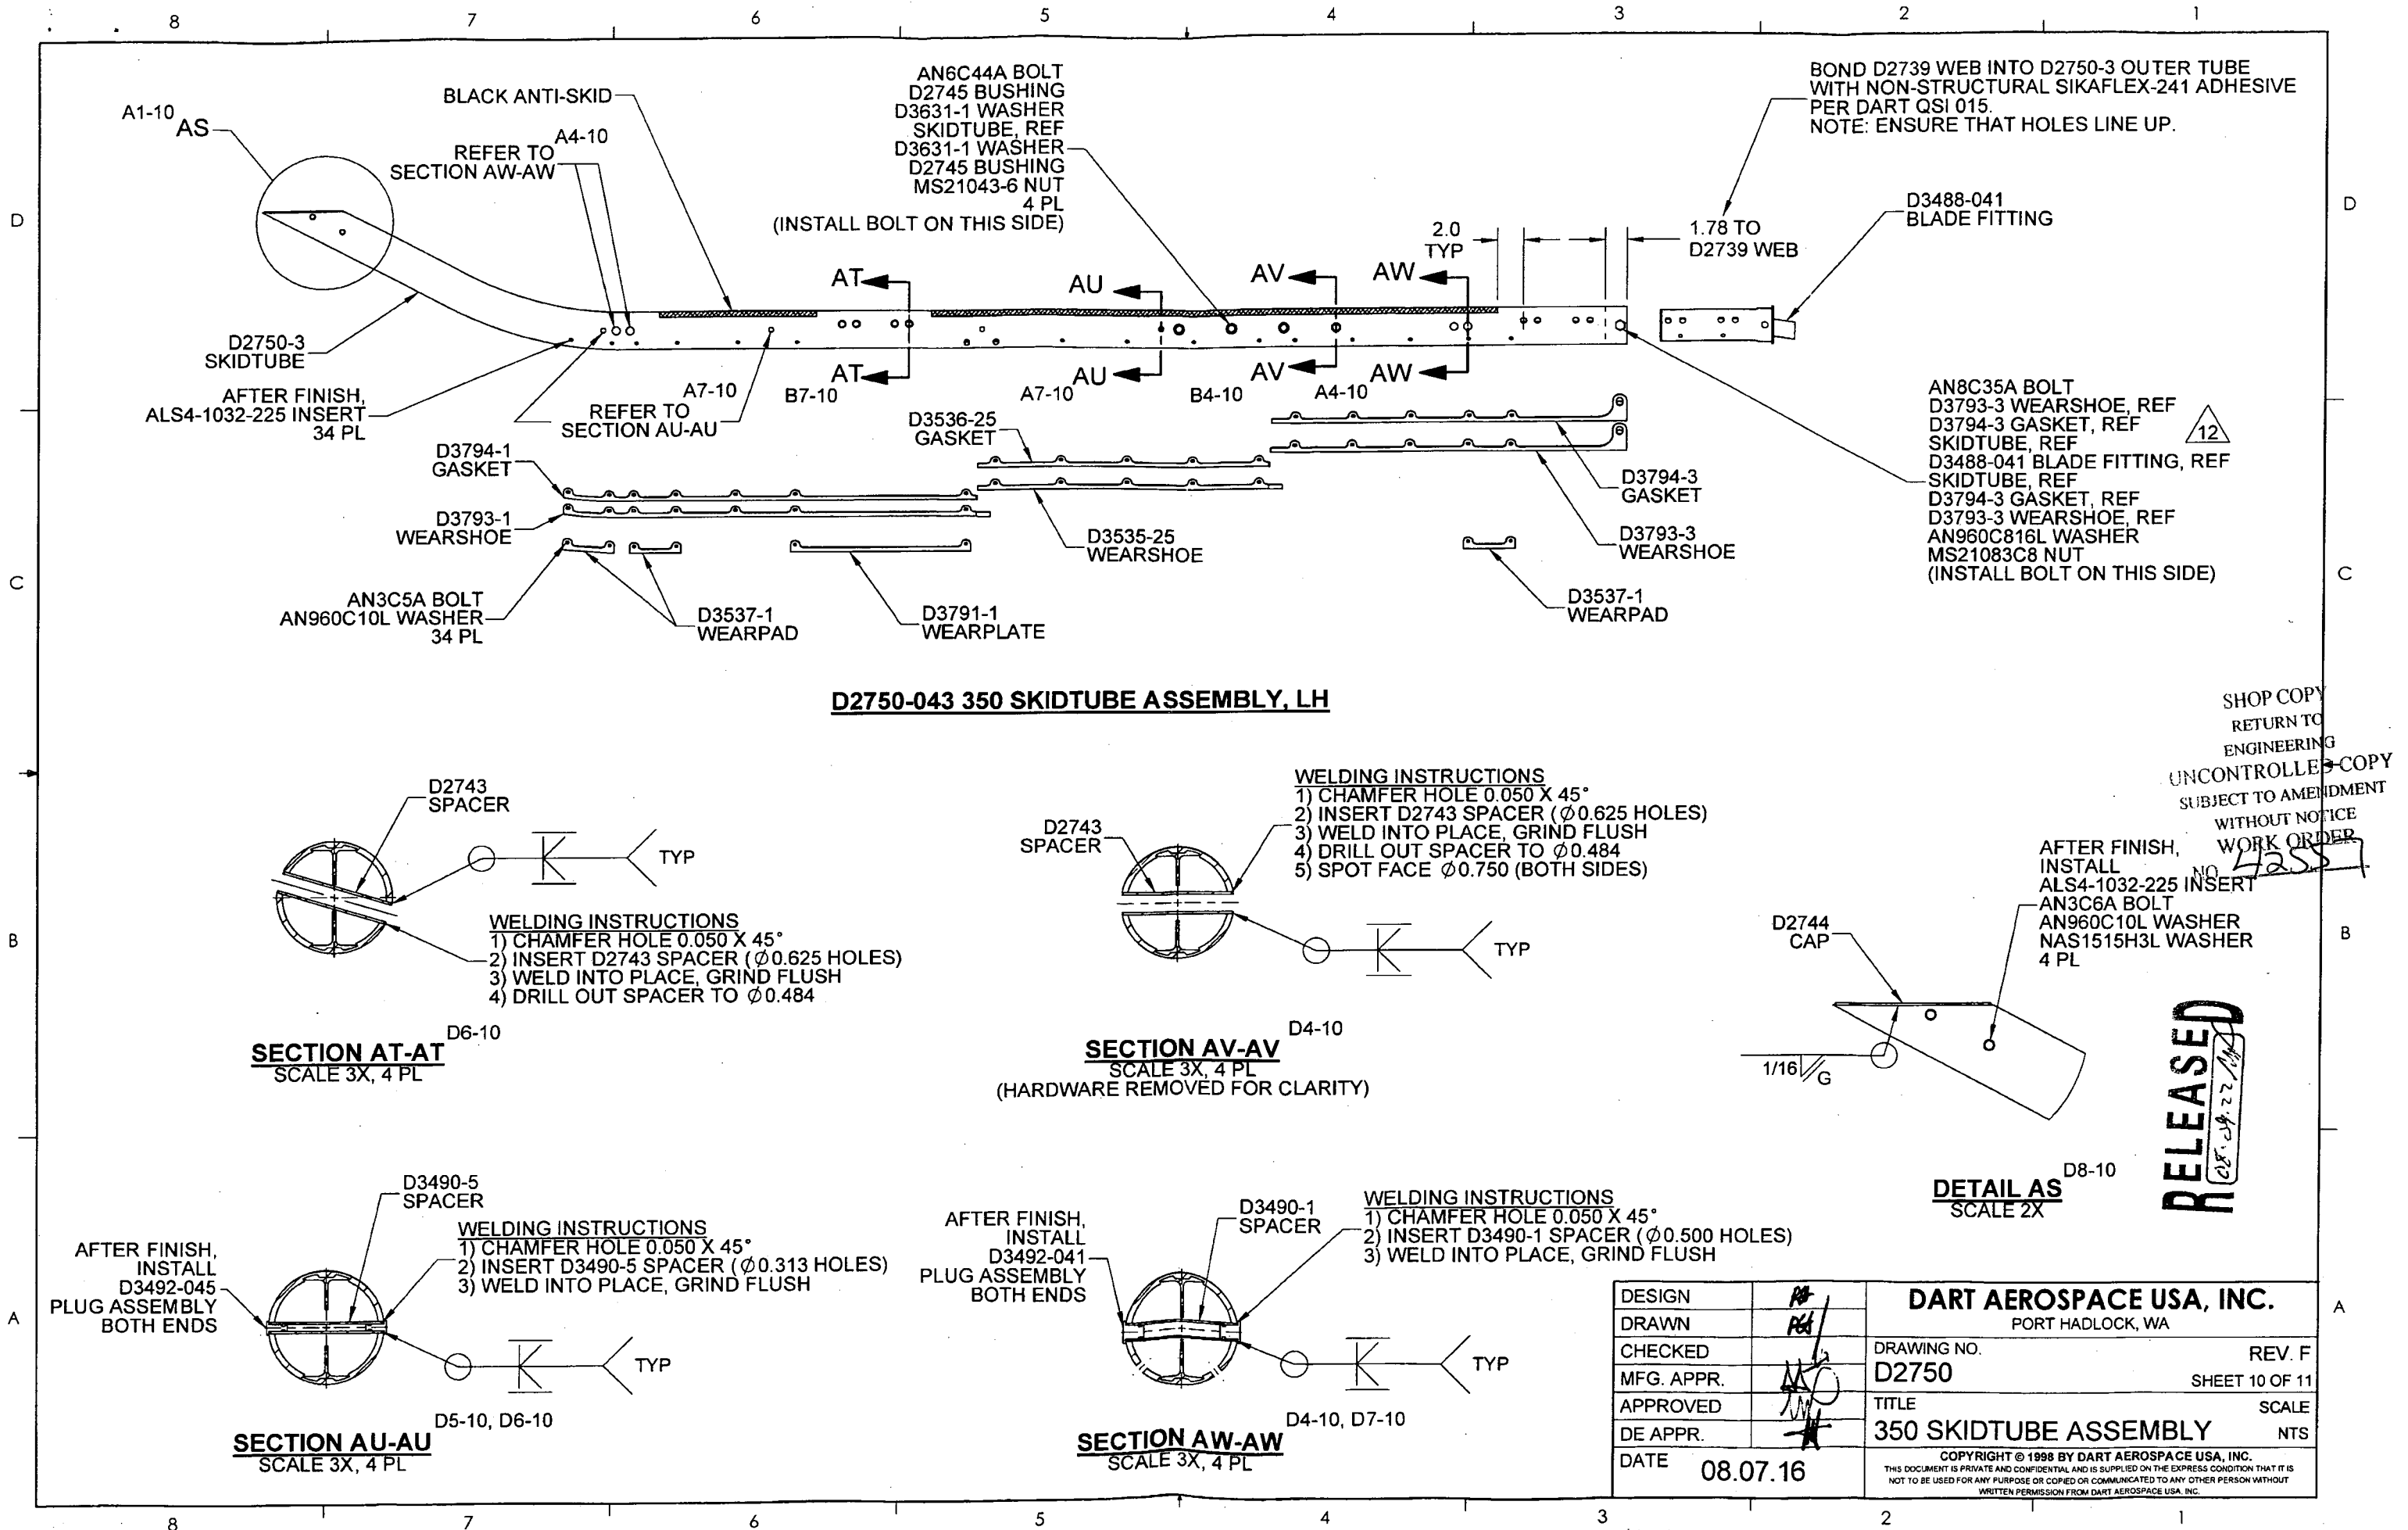


DESIGN	PA	DART AEROSPACE USA, INC.	
DRAWN	PA	PORT HADLOCK, WA	
CHECKED	PA	DRAWING NO.	REV. F
MFG. APPR.	PA	D2750	SHEET 10 OF 11
APPROVED	PA	TITLE	SCALE
DE APPR.	PA	350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	


8 7 6 5 4 3 2 1

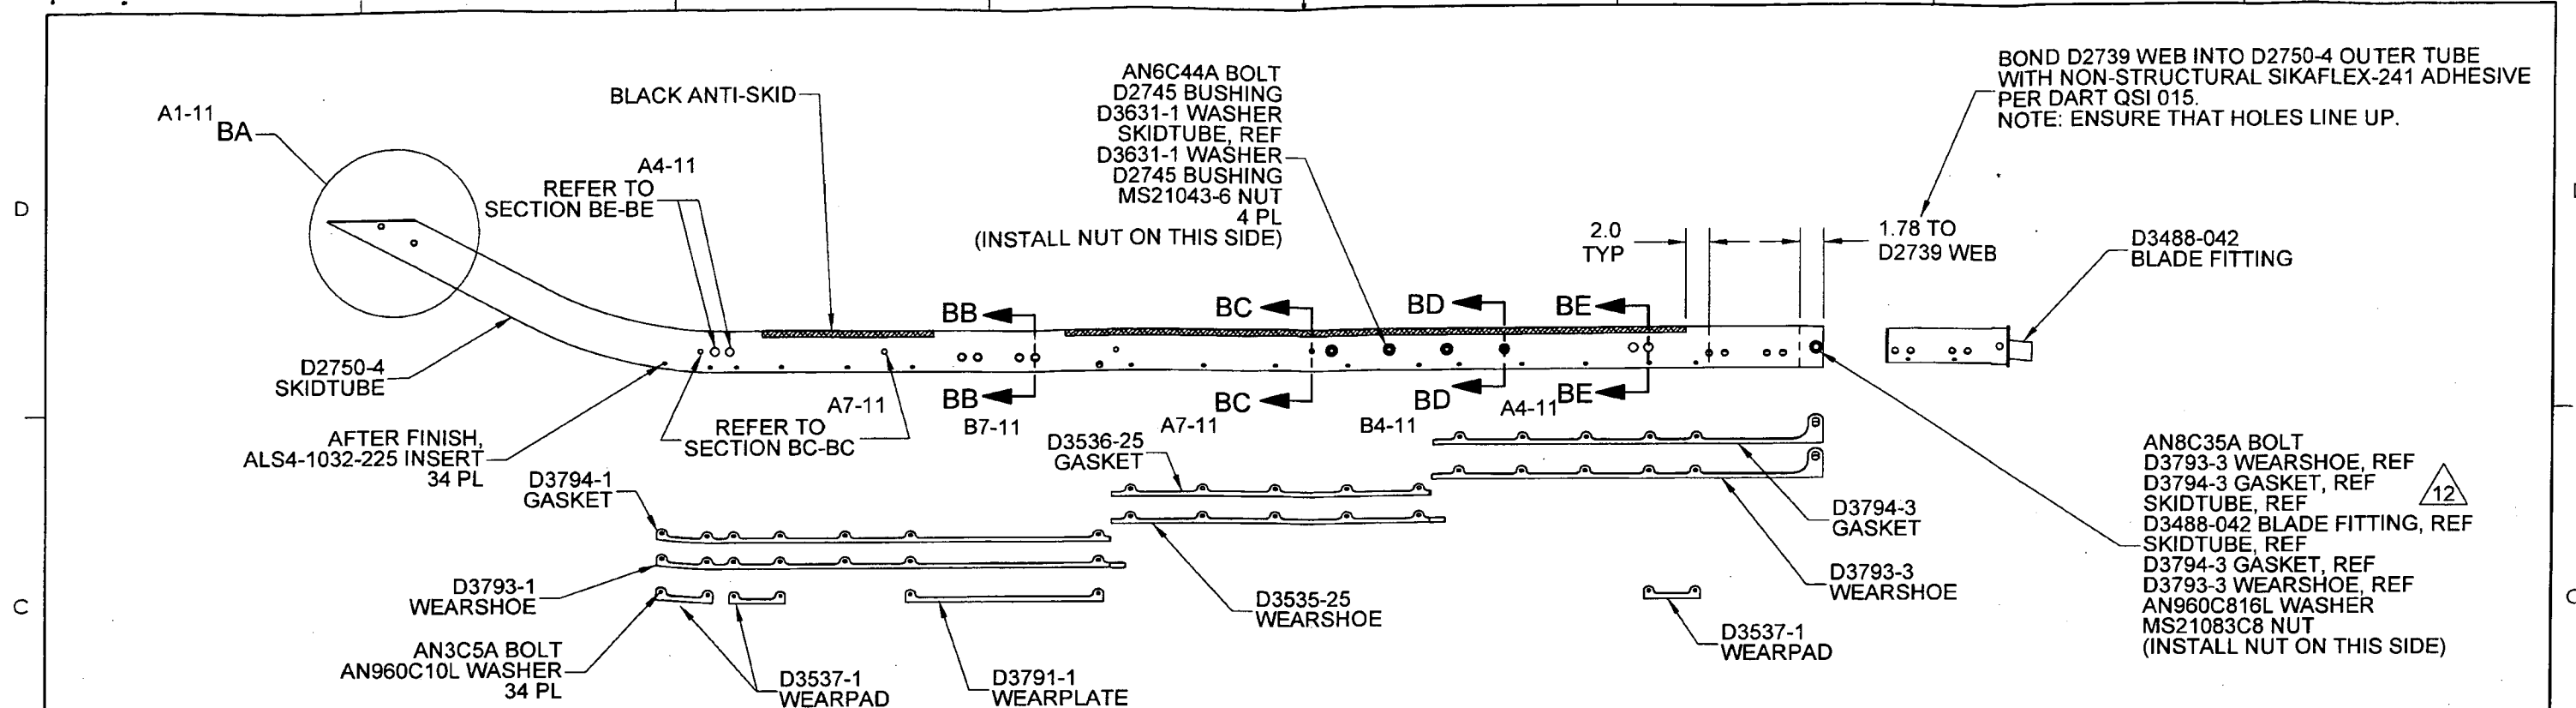


D2750-044 350 SKIDTUBE ASSEMBLY, RH

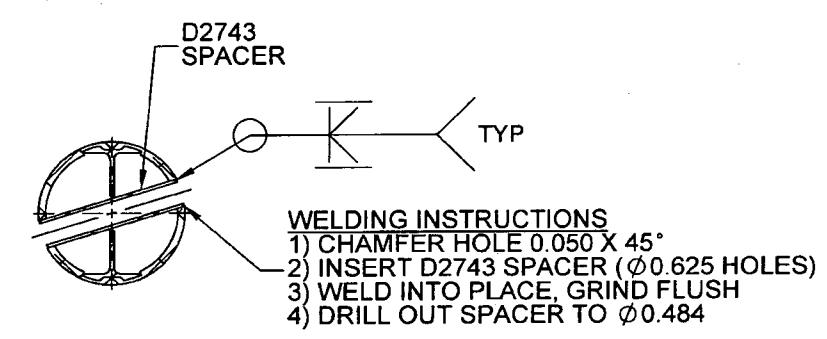


SECTION BB-BB
SCALE 3X, 4 PL

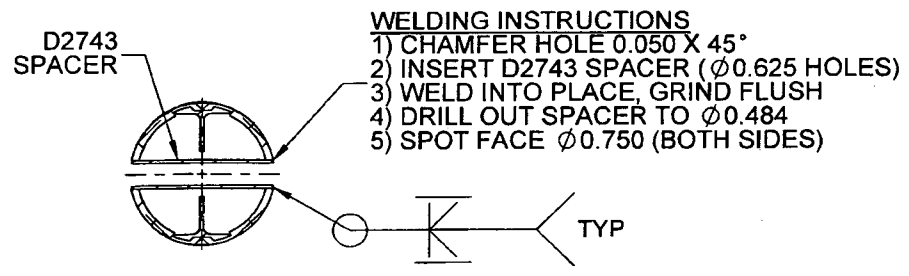

SECTION BD-BD
SCALE 3X, 4 PL
(HARDWARE REMOVED FOR CLARITY)

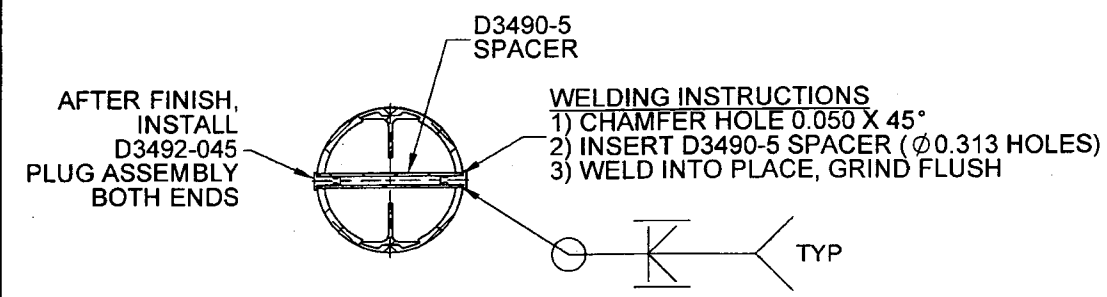


SECTION BC-BC
SCALE 3X, 4 PL

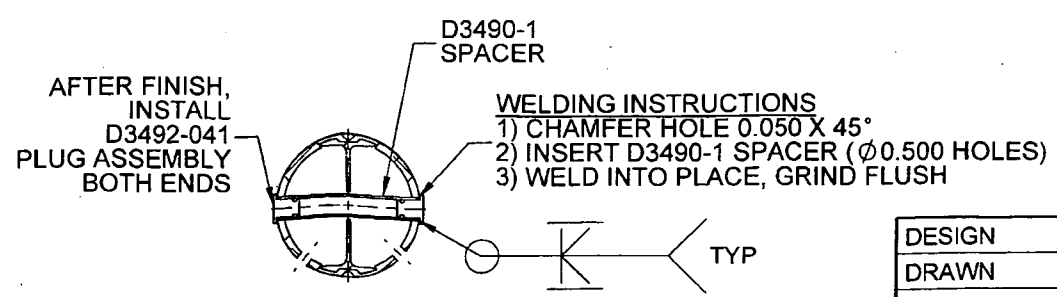

SECTION BE-BE
SCALE 3X, 4 PL

RELEASED
08-07-16

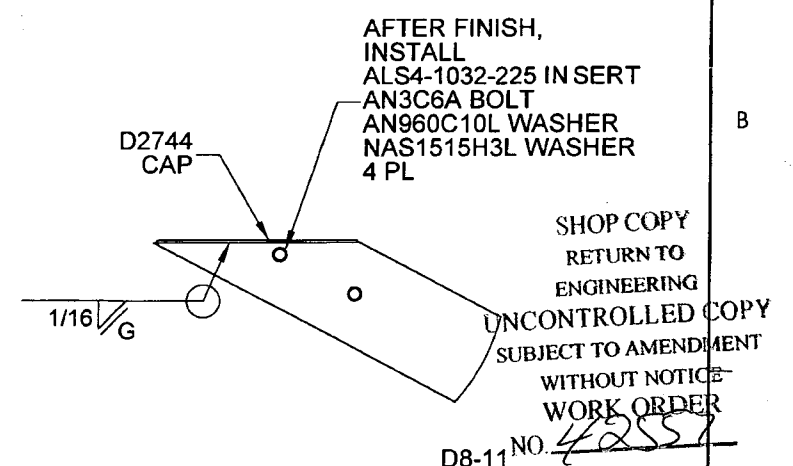

DETAIL BA
SCALE 2X

DESIGN	RE	DART AEROSPACE USA, INC.	
DRAWN	RE	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2750	SHEET 11 OF 11
APPROVED		TITLE	SCALE
DE APPR.		350 SKIDTUBE ASSEMBLY	NTS
DATE	08.07.16	COPYRIGHT © 1998 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

